


PROTOCOLO i2C
iPHONE 12 PRO MAX

I2C2 AP SCL/SDA

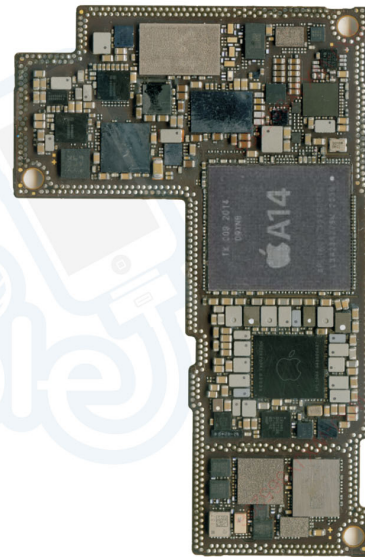

BOOTLOOP CON LOGO 5 SEGUNDOS

REVISE: AMPLIFICADOR SUPERIOR U8100, PULL UP R2340,R2341 (1.2V)


AL METER SISTEMA CON ESTA FALLA NOS ARROJARA ERROR 4013 EN 3UTOOL (ITUNES FLASH)



Giño Morales

PROTOCOLO i2C
iPHONE 12 PRO MAX

I2C1 SMC SCL/SDA

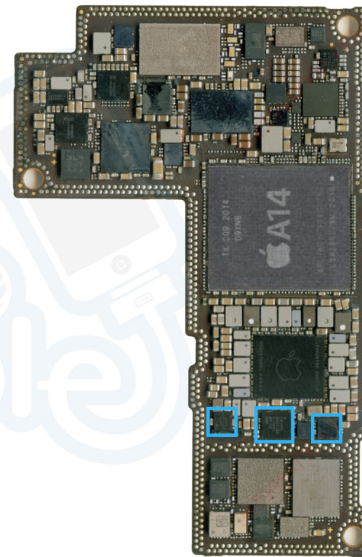

BOOTLOOP SIN LOGO LLEGA 440mA

REVISE: GECKO2 (U9500), PARROT (U9600), KRAKEN (U9300), PULL UP R2460/R2461 (1.2V)


NO ENTRA A RECOVERY, SE FORZA A DFU Y DA ERROR AL 11% EN 3UTOOLS SIN IMAGEN (EASY FLASH)



Giño Morales

PROTOCOLO i2C
iPhone 12 PRO MAX

I2C0 AOP SCL/SDA 1V8

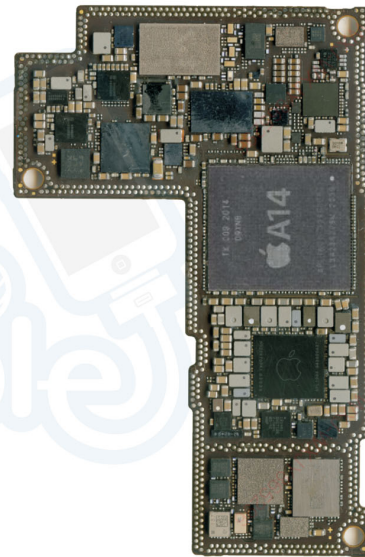

BOOTLOOP CON LOGO 5 SEGUNDOS

REVISE: FLEX AURICULAR (BANE-YOGI), ACOPLADOR DOBLE U2420 (EN SERIE)

AL METER SISTEMA CON ESTA FALLA NOS ARROJARA ERROR 4013 21% EN 3UTOOL (ITUNES FLASH)



Giño Morales